

Intelligent Sensor Soap Dispenser

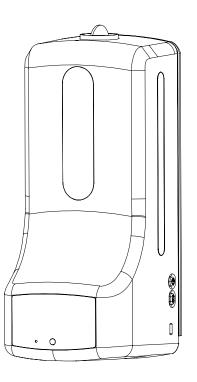

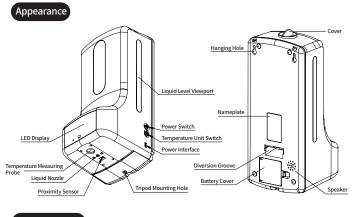

Specification

- 1.Accuracy: $\pm 0.2^{\circ}\text{C}\,$ (34~45°C, put it in the operating environment for 30 minutes before use)
- 2.Alarm type: flashing + bleeping "DIDIDI"
- 3.Measuring distance: 5cm~10cm
- 5. Interface: Type-C
- 6.Bottle Capacity: 1000mL
- 7. Mounting Type: Wall-hanging, Tripod-fixed
- 8.Working Temperature: 10°C~40°C (15°C~35°C Recommended)
- 9.Measuring range: 0~50°C
- 10.Response time: 500ms
- 11.Standby time: 5s for non-working, dynamic loop with white light
- 12.Power Supply: DC 5V 1500MA(or 4 AA batteries)
- 13.Dimension: 119*133*280mm
- 14.Liquid type: hand sanitizer or liquid disinfectant

Conditions

1. Standby: the white dot on the bottom of right corner flashing by turns. (Fig. 1)





(Fig.1)



2. Normal temperature: displays current temperature and green light flashes once on the display. (Fig. 2)

3. Abnormal temperature: displays current temperature and red light flashes on the

display. (Fig. 3)

4. Out of measuring range(Note: do not spray hand sanitizer):

"Lo": Ultra-low temperature alarm.(Fig. 4); "Hi": Ultra-high temperature alarm. (Fig. 5)





Instructions

1. Temperature measuring and hand washing: Put your hand on the bottom until you hear a "DI" sound, then the LED screen will display the temperature and hand sanitizer squeezed out. (Fig. 6)



2. Function of button:

(1) Button ①: Function setting(Fig. 7)



Press the button ② to switch between Celsius and Fahrenheit C: Celsius F:Fahrenheit (Fig. 9, Fig. 10)





Press the button ① twice to set the working mode

Press the button ② to switch the working mode. Bo:body mode co:counting mode sur:surface mode



Press the button $\ensuremath{\textcircled{\scriptsize 1}}$ 3 times to set the alarm temperature Press the button ② to switch the alarm temperature between 36°C to 39°C

Press the button ① 4 times to set the volume
Press the button ② to switch the volume from U0 to U4



Press the button ① 5 times to set the language Press the button ② to set the language CH/EN/KO/PT/ES CH: Chinese EN: English KO: Korean PT: Portuguese ES: Spanish



Press the button 1 6 times to set the squeeze amount of hand sanitizer Press the button 2 to set the extrusion time between 0.1 and 2.0 seconds


E2.0

Press the Button ① for 2S or more: on/off

(1)Tripod mounting: There is screw connection on the bottom which can be connected with tripod. (Fig. 11)




(2) Wall-handing: There are two handing holes on the back side can be fixed with nail. (Fig. 12)



(Fig. 12)




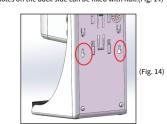



(1)

(Fig. 16)



(7)Battery installation: Open the battery cover, take out the battery box, unscrew the screws and put in 4 AA batteries (Fig. 17).



(Fig. 17)

Warnings

- 1. Do not pour hand sanitizer into Temperature Measuring Probe and Proximity Sensor
- 2. Make sure that it is standing upright after filling in hand sanitizer.

